247212

FILED ON:

11/11/2025 03:52 PM CORTNEY BRITTEN CLEEREMAN REGISTER OF DEEDS

> FOREST COUNTY WI PAGES: 1

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3) (a)(b)(c)(d)(e)(f)(g)(h)(i).

The coordinate value shown has been verified by at least one of the following methods: 1) Comparison to a previously GNSS determined published value; 2) The value is the average of two or more GNSS observations at a markedly different time; 3) One or more distances were measured back to the GNSS observed corner from temporary GNSS observed offset locations.

A-E 7.08(3)(a) Identity of the corner:

Meander Corner Section 6

Township 34 North

Range 13 East

Town of Nashville

County of Forest

WISCRS - Forest County

N: 531618.654 USFT

E: 836127.397, USFT

Datum: NAD 83 (2011)

GNSS Method: WISCORS VRS Direct Observation


Original Corner Information:

Original Surveyor: J.L. Nowlin

Date of Survey: October 1865

Original B.T.'s: Fir 8" - N2°W, 20 links

Aspen 9" - N40°E, 3 links

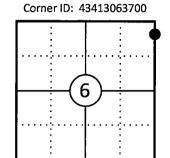


A-E 7.08(3)(b)(e)(f)(g) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence considered. Describe any discrepancy between the corner restored and any previously established location. State whether the corners was restored through acceptance of obliterated evidence, a found perpetuated location, or determined by proportionate methods.

11/11/1975 Certified Land Corner Restoration by Thomas R. Arnott indicates a 1-1/2" dia. iron pipe was found and replaced with a new Forest County aluminum monument and made two bearing trees. (See corner form for prior history and additional


10/09/1975 L. Ernest George, Certified Survey Map Vol. 2, Pg. 121 indicates an iron pipe set.

03/03/2025 I found and accepted a 1-1/2" dia iron pipe at the corner location that agreed with measurements to the section corner to the north and an iron pipe to the northwest as shown on the Certified Survey Map by George. I also found another 1-1/2" dia. iron pipe S05°21'21"W, 2.64' of unknown origin. I did not find the aluminum monument called for by Arnott or his bearing trees. I made four new bearing trees to witness the corner as shown below.

A-E 7.08(3)(c)(d)(e)(h) Plan view of corner with ties to at least four witnesses. If in disagreement with previously established corner, show the distances between the two corners and also indicate the tie to the disputed corner. Distances and directions to other PLSS used as evidence or for proportioning.

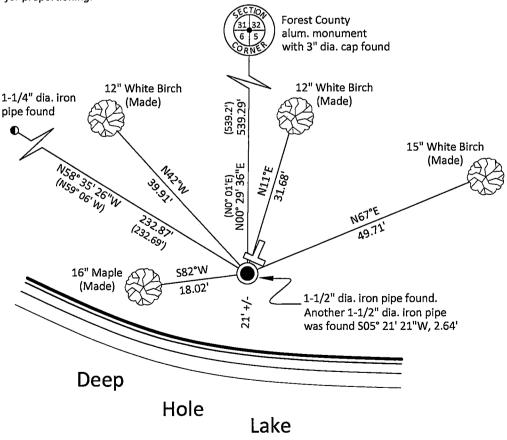

Bearings given to the nearest second are Forest County Grid all other bearings are magnetic

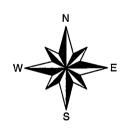

- Vinyl "T" post 0.6' northeast of corner.
- Distances to bearing trees are to nail in side.
- Sketch is not to scale



A-E 7.08(3)(i) - Certification

I, Gregory S. Maines, Professional Land Surveyor No. 2729, hereby certify that the corner location on this record was referenced by me or under my direction and control and that this U.S. Public Land Survey Monument Record is complete to the best of my knowledge and belief.

State of Wisconsin County of Forest I Thomas: R. Arnott , do hereby certify that on the 21st day of September , 1975 , I found evidence of the M.C. corner of sections 5 & 6 north Township 34 , North, Range 13 E , Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original	History of original corner establishment: Original subdivision by James L. Nowlin Oct. 3 - Oct. 16,1865 Fir 8 N2W 20 Lks. AAspen 9 N4OE 3 Lks. Deephole Lake Description of corner evidence found: 1½" iron pipe found
location of this corner.	
Resident witnesses:	
Herbert Wagoner	م.
	Description of monument and accessories I established to perpetuate the original location of this corner. Reset pipe with a new Forest County aluminum monument Ties: Maple 8 S87E 17.67 feet Maple 8 S30W 15.87 feet Maple 8 S30W 15.87 feet Dated at Crandon Wis, this 11th day of November 19.75
 	
6	Signature / Number Registration No. S=887 (County Surveyor, Registered Land Surveyor, or other duly authorized official) Office of Register of Deeds, County of Forest , I hereby certify that the within instrument was filed in this office for record on the 11th day of November , 19.75 at 4 o'clock . M. Document Number 108204
O = Corner monument restored.	By Deputy

CERTIFIED LAND CORNER RESTORATION

43413663

Index No. B - 5