FILED ON: 11/11/2025 04:02 PM CORTNEY BRITTEN CLEEREMAN REGISTER OF DEEDS

> FOREST COUNTY WI PAGES: 1

Corner ID: 43413270020

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

This form is intended and designed to fulfill all requirements of Wisconsin Administrative Code, Chapter A-E 7.08 U.S. Public Land Survey Monument Record (3) (a)(b)(c)(d)(e)(f)(g)(h)(i).

The coordinate value shown has been verified by at least one of the following methods: 1) Comparison to a previously GNSS determined published value; 2) The value is the average of two or more GNSS observations at a markedly different time; 3) One or more distances were measured back to the GNSS observed corner from temporary GNSS observed offset locations.

A-E 7.08(3)(a) Identity of the corner:


S 1/4 Corner Section 27 WISCRS - Forest County Township 34 North N: 506057.382 USFT Range 13 East E: 848428.238 USFT Town of Nashville Datum: NAD 83 (2011)

County of Forest GNSS Method: WISCORS VRS Direct Observation

Original Corner Information:

Original B.T.'s: Hemlock 18" - S45°E, 18 links Hemlock 16" - N5°W, 15 links Original Surveyor: J.L. Nowlin

Date of Survey: October 1865



A-E 7.08(3)(b)(e)(f)(g) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence considered. Describe any discrepancy between the corner restored and any previously established location. State whether the corners was restored through acceptance of obliterated evidence, a found perpetuated location, or determined by proportionate methods.

02/11/1963 Certified Land Corner Restoration by Neal Sperhake indicates he set a 1" dia. iron pipe with a Kimberly Clark Corp aluminum cap from an original bearing tree and made two bearing trees. (See corner form for prior history and additional information).


03/20/2003 Dean Williams, Forest Co Surveyor File # 341327-20030320 indicates a 4" brass tab Co. Mon.

02/07/2007 Timothy J. Rusch, Forest Co Surveyor File # 341333-20070207 shows a found aluminum capped survey monument.

05/07/2025 I found and accepted a 1-1/4" dia. iron pipe with a Kimberly Clark Corp 4" dia. aluminum cap stamped to identify the corner 10" above grade at the corner location along with five bearing trees, two of which are now dead. I used three of the existing bearing tress and made one new bearing tree to witness the corner as shown below.

A-E 7.08(3)(c)(d)(e)(h) Plan view of corner with ties to at least four witnesses. If in disagreement with previously established corner, show the distances between the two corners and also indicate the tie to the disputed corner. Distances and directions to other PLSS used as evidence or for proportioning. Bearings given to the nearest

second are Forest County Grid. All other bearings are magnetic

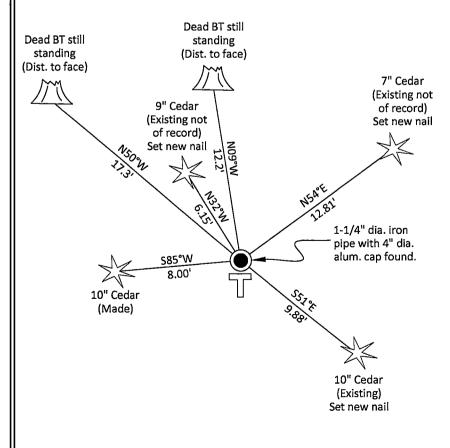



- Vinyl "T" post 0.7' south of corner and a steel fence post was found 0.5' west
- Distances to bearing trees are to nail in side with BT tag on tree.
- Sketch is not to scale



A-E 7.08(3)(i) - Certification

I, Gregory S. Maines, Professional Land Surveyor No. 2729, hereby certify that the corner location on this record was referenced by me or under my direction and control and that this U.S. Public Land Survey Monument Record is complete to the best of my knowledge and belief.

	1 1		- -
- -	 		 -
	 - 	- .	। अ: ।

O = Corner monument restore	d.
-----------------------------	----

State of Wisconsin

corner of SECTION 34

location of this corner.

Resident witnesses:

FOREST

I NEAL SPERHAKE , do hereby certify that on the FIFTEENTH day

of NOVEMBER , 19.61 , I found

evidence of the NORTH QUARTER SECTION

Township......34...., North, Range, North Principal Meridian,

as described hereon; and that from this evidence I established a new monument and accessories

as described hereon to perpetuate the original

Richard Piontek - Waubeno

David Pichotta - Waubeno

. County of.....

SS.

CERTIFIED LAND CORNER RESTORATION

Index No.

History of original corner establishment:

.This corner can also be described as: THE QUARTER SECTION CORNER BETWEEN SECTIONS 27 AND 34, T34N-R13E, 4TH P.M.

This corner was established during the original survey of this township, as noted in the Original Field Notes for the Original Survey of T34N-R13E, 4th P.M.

Description of corner evidence found:

The original bearing tree, described in the original field notes as,

"Hemlock 16 N5W 15 links"

is still present at this date, with a portion of the original scribe marks still visible.

Description of monument and accessories I established to perpetuate the original location of this corner. At the site of the original post, as determined from the existing original bearing tree noted above, I emplaced a "GALVANIZED IRON PIPE, THREE FEET LONG, ONE INCH IN DIAMETER, WITH AN ALUMINUM CAP DENOTED AS, 'KIMBERLY-CLARK CORP T34N 1/4 BTWN 27 & 34 R13E SPERHAKE RLS 463 11-15-61".

The pipe is witnessed by: Cedar 4 N14W 19½ links. (Scribed S27 NBT).

Cedar 5 S52E 16 links. (Scribed S34 NBT).

Dated at	Crandon	, Wis, this	11th	dav of	Feb	, ₁₉ 63
Signature		Title Re	gistered La	and Surveyor	Registrati	ion No. <u>\$-463</u>
Office of Regist	er of Deeds, County of filed in this office for r				, I hereby certif	y that the within
at.10o'clo	ockA. M.	86843	SUBSCI	RIBED & SWOI	N TO BEFORE	
ann	a Seter		<i>(</i> [PFEB 1963	Leter	son
D.	(Register of De	eas)		y Public, Fo Comm. exp.	rest Co., Wi 10/31/65	.S.
By .			Deputy			