

!Attention!

This PLSS corner is in the process of being updated by Forest County. An updated Tie Sheet will be available for this corner soon.

Please contact Kayla at the Forest County Land Information Department for more information.

Contact Info:

715-478-1387 or Kayla.L@co.forest.wi.us

U. S. PUBLIC LAND SURVEY MONUMENT RECORD


I N S T R U C T I O N S :

This record shall show the location of the corner and shall include all of the following nine elements (a through i).

- (a) Identify the corner by reference to the U.S. public land survey system.

○ = Corner monument restored.

Section corner to Sections 1, 6, 7, and 12,
T.36N., R.16-17E.

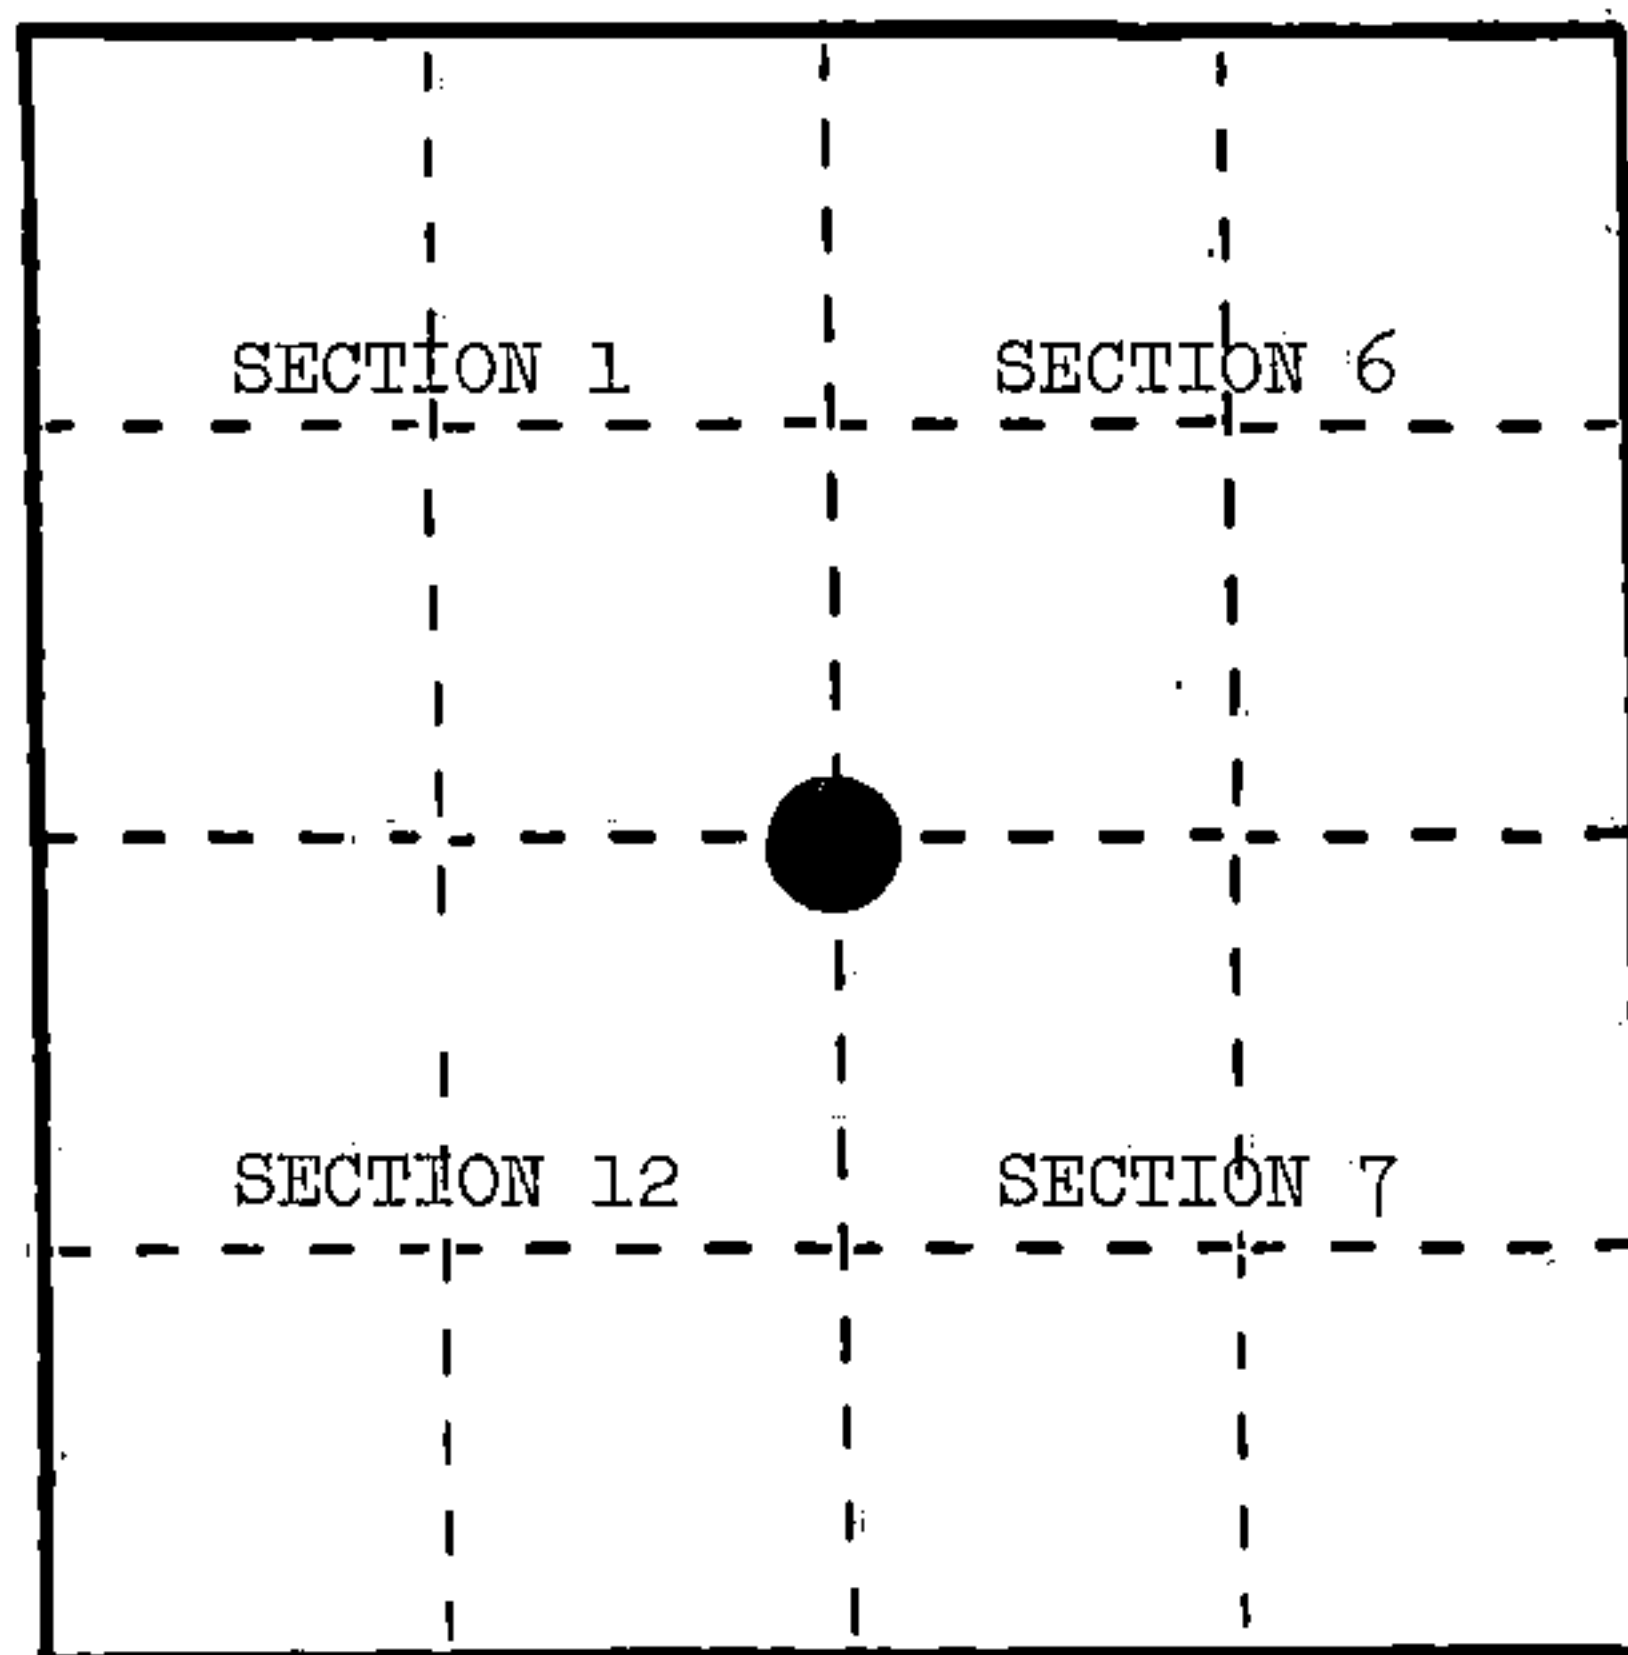

- (b) Describe any record evidence, monument evidence, occupational evidence, testimonial evidence or any other material evidence you considered, and whether the monument was found or placed.

In 1857, Artemas Curtis set post with the following BTs: Hemlock, 16", S.78°W., 17 links; Yellow Birch, 16", N.38°W., 23 links; Hemlock, 10", N.39°E., 48 links; Hemlock, 12", S.22°E., 17 links.


In 1937, Gould and Hammes set iron pipe with brass cap. Set new BTs as follows: Cedar, 8", S.02°W., 70.4 links; Cedar, 6", S.81°W., 130.3 links.

November 30, 1984, Alan Harrison found the following: 4" diameter iron pipe with brass cap; Cedar, 12", S.02°W., 46.46'; Cedar, 8", snag, S.81°W., 86.00'; Hemlock stump, S.22°E., 11.2', "original."

- (c) In the plan view drawing below, provide reference ties to at least 4 witness monuments, or, if the location is within a municipality, to at least 2 witness monuments. (Witness monuments shall be made of concrete, natural stone, iron or other equally durable material.)
Describe witness monuments.

- (d) Show a plan view drawing depicting the relevant monuments and reference ties which is sufficient in detail to enable accurate relocation of the corner monument if the corner monument is disturbed. Indicate north.

1. 4" brass cap stamped to identify the corner.
2. Black Cherry, 8", S.86°E., 47.84'
3. Cedar, 12", S.5°W., 46.96'
4. Balsam, 5", S.44°W., 25.42'
5. Black Cherry, 6", N.30°W., 21.49'

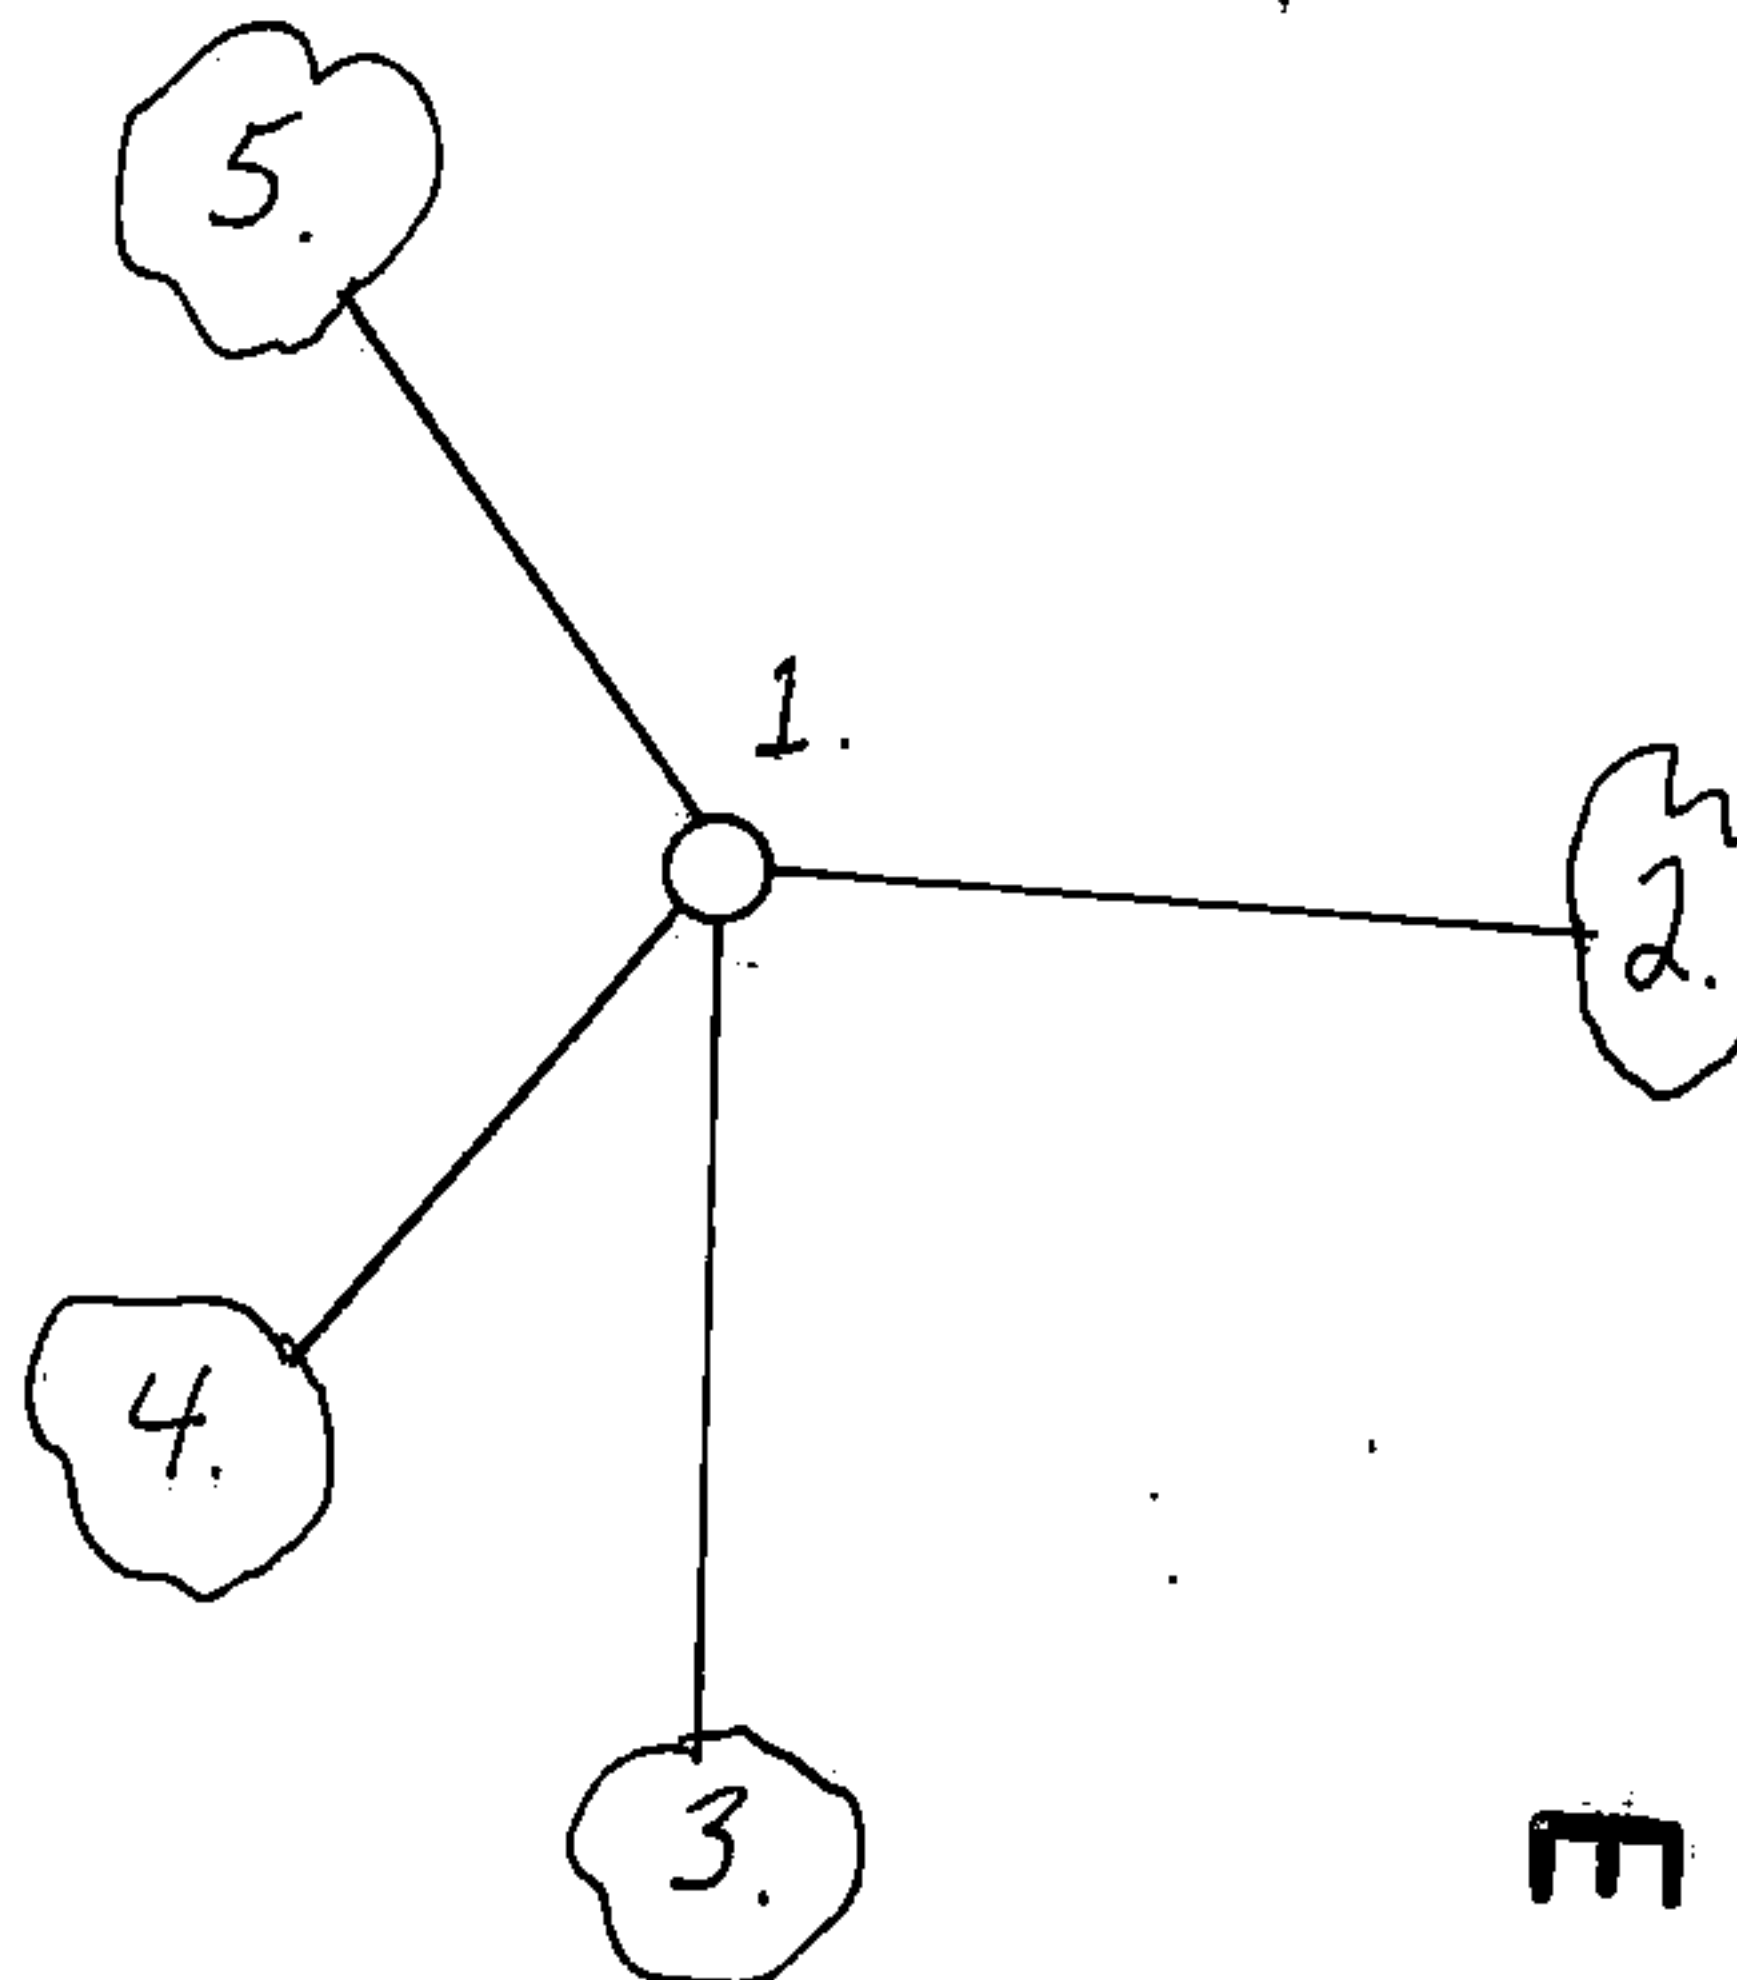

REGISTER'S OFFICE }
Forest County, Wis. }

Received for record this... 23rd day
of January, 1985 at
9:00 o'clock A.M. and

recorded in Vol. CORNER RESTORATION
on page 25

Paul A. Schenck
REGISTER

E-25

- (e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

None.

- (f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(2) a found perpetuated location.

- (g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

- (i) I, Alan D. Harrison
(Type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

Alan D. Harrison
Signature

12/14/84
Date

