




# U.S. PUBLIC LAND SURVEY MONUMENT RECORD

Index No. L-25

State of Wisconsin }  
County of FOREST } ss.

I, John Schulke, do hereby certify that on the 10th day of October, 1989, I found evidence of the East Quarter corner of Section 13 Township 37 North, Range 12 East, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner.

Resident witnesses:

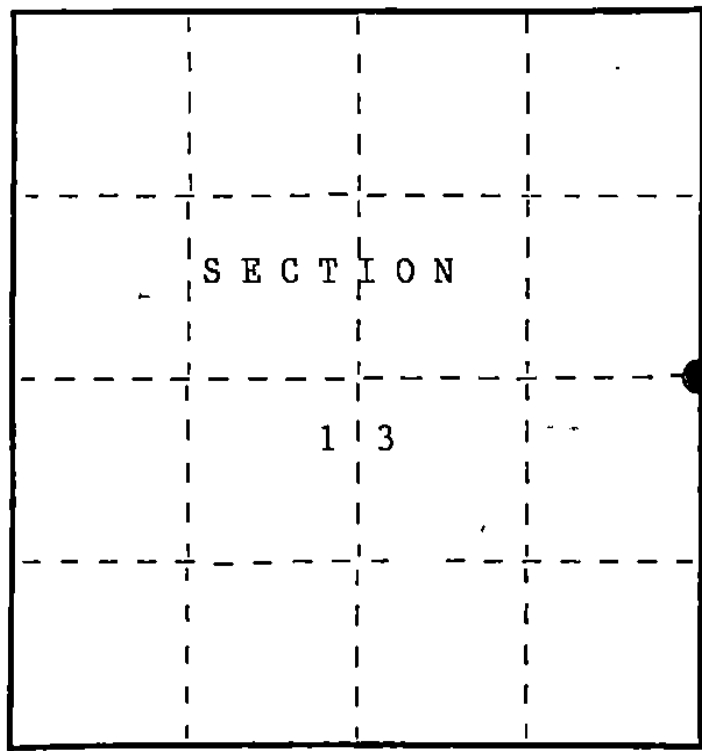

● = Corner monument restored.

## History of original corner establishment:

In 1858, Original Government surveyed by Alfred Millard. Set a wood post with the following corner references:  
Y. Birch 14" S79°W 24 lks.  
Sugar 8" N40°E 18 lks.

## Description of corner evidence found:

In 1989, John Schulke found a 1 1/4" dia. X 3 ft. well point at the fence corner. Fences runs North, South and West, I accept the location as the best available evidence of the original corner. Replaced iron pipe with an aluminum monument.

## Description of monument and accessories I established to perpetuate the original location of this corner.

Set a 2 1/2" X 36" aluminum magnetic cap monument stamped to identify the corner. Monument placed in a mound of stones. The fence corner post bears West a distance of 0.8 ft. from the monument. Fence lines runs West and North from the corner post. Set a steel sign post 0.7 ft. Northeast of the monument. The following corner references:

Clump of Basswood	16"	N33°E	37.74 ft.
Aspen	6"	S68°E	21.77 ft.
Sugar Maple	6"	S16°E	94.67 ft.

Dated at Ludington, MI, this 3rd day of November, 1989.

Signature: John C. Schulke Title: Register Land Surveyor Registration No. S-1665  
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest, I hereby certify that the within instrument was filed in this office for record on the 8th day of March, 1990 at 1:00 o'clock P.M.

Paul Aschenbrenner  
(Register of Deeds)

By Deputy

FORM NO. 985-A  
H.C. Miller Company  
Lansing, Michigan

Stock No. 26273

DOCUMENT NUMBER  
139259

4371213 2000

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

No.

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?


(1) an obliterated evidence location.

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

No.

QUARTER CORNER  
S13 | S18  
R12E | R13E

1. Monument
2. Aspen 6" S68°E 21.77 ft.
3. Clump of basswood 16" N33°E 37.74 ft.
4. Sugar Maple 6" S16°E 94.67 ft.
5. Steel sign post NE 0.7 ft.

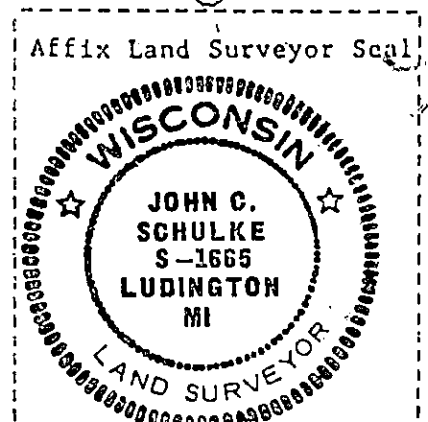

(i) I, John Schulke (RLS-1665)  
(type or print name) certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

John C. Schulke Signature Nov 3rd, 1989 Date

Survey requested by Dale B. Staeger 1989  
District Ranger Date