

!Attention!

This PLSS corner is in the process of being updated by Forest County. An updated Tie Sheet will be available for this corner soon.

Please contact Kayla at the Forest County Land Information Department for more information.

Contact Info:

715-478-1387 or Kayla.L@co.forest.wi.us

CERTIFIED LAND CORNER RESTORATION

State of Wisconsin }
County of Forest } ss.

I William B. Cochrane, do hereby certify that on the 11th day of August, 1983, I found evidence of the Southwest Section corner of Section 13 Township 38 North, Range 14 EAST, Fourth Principal Meridian, as described hereon; and that from this evidence I established a new monument and accessories as described hereon to perpetuate the original location of this corner:



Description of original monument and accessories and subsequent restorations:
Surveyed in 1865 by H. and J.L. Nowlin
80.00 chains north between sections 23 and 24 set corner to sections 13, 14, 23 and 24
Spruce, 5", S80°E, 12 links
Tamarac, 6", S18°W, 105 links
4 chains South leave marsh NE-SW
2 chains East leave marsh NE-SW
3.5 chains West, stream 20 links wide, runs NE and leave swamp NE-SW
5.50 chains north, stream 15 links wide, runs east.

Description of corner evidence found:
On July 5, 1934, Stewart Morey found a wood post set by Peter Netzer in 1914 also found a spruce, 10", S-E, .10 chains. In 1917 the railroad center line survey tied to the corner from the west and north.
I found a very old faintly scribed 6x6 wood post and a 2 inch diameter pipe at the corner position. No original bearing trees were found. The railroad center line survey was retraced and the railroad ties and original calls to the marsh and river from the old post fit to within a foot of the recorded distances.

Description of monument and accessories I established to perpetuate the location of this corner:

From the evidence found I accepted the position of the old wood post and replaced it with a 2 1/2 inch diameter, aluminum pipe monument, 5 feet long, with an aluminum cap stamped: T38N R14E, S13, S14, S23, S24, 1983, S-1107
From the following bear:
Maple, 7", S47°E, 121.06 feet
Spruce, 12", S4°W, 166.70 feet
Steel sign post, West, 0.50 feet

DOCUMENT NO.
124408

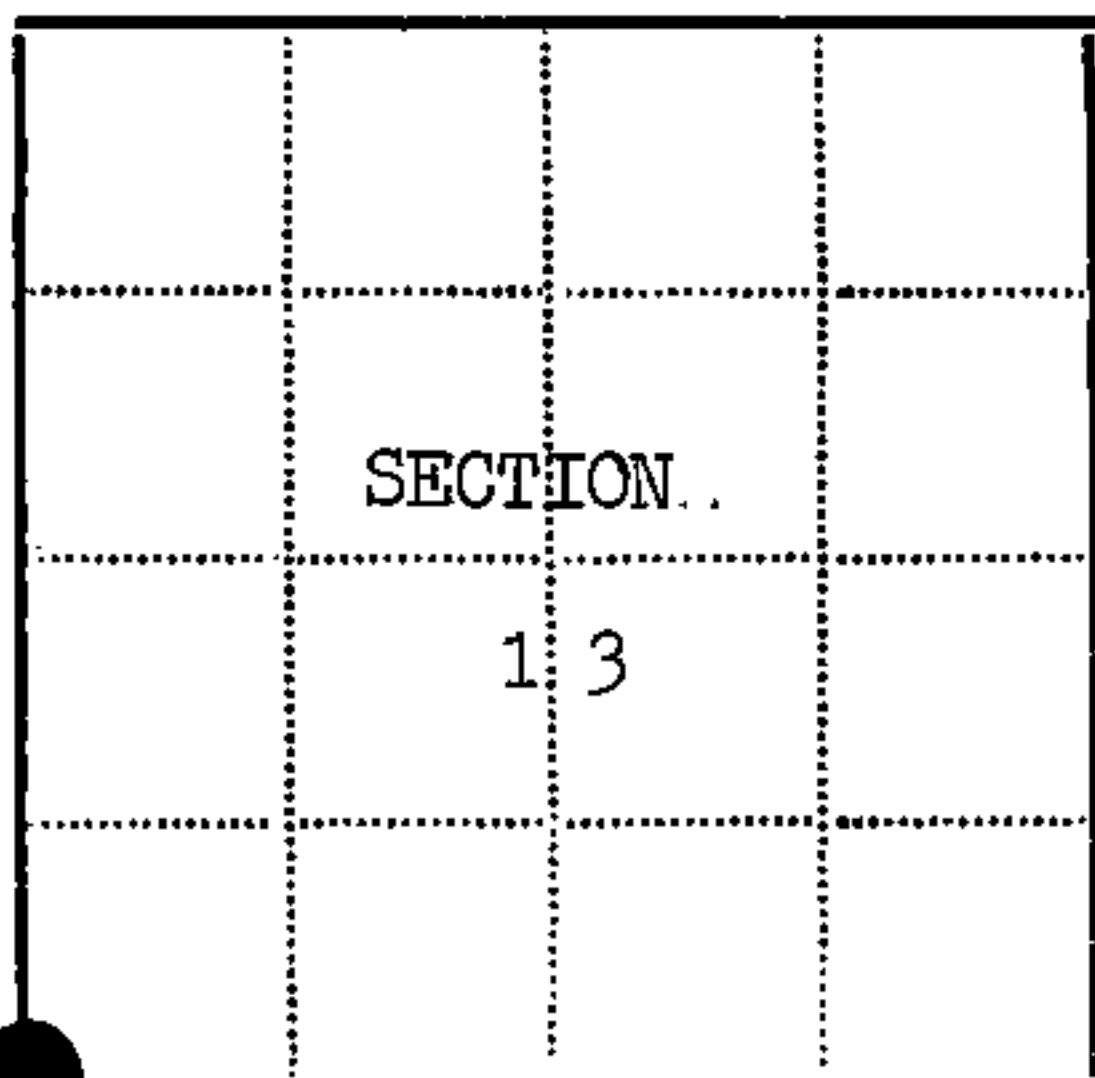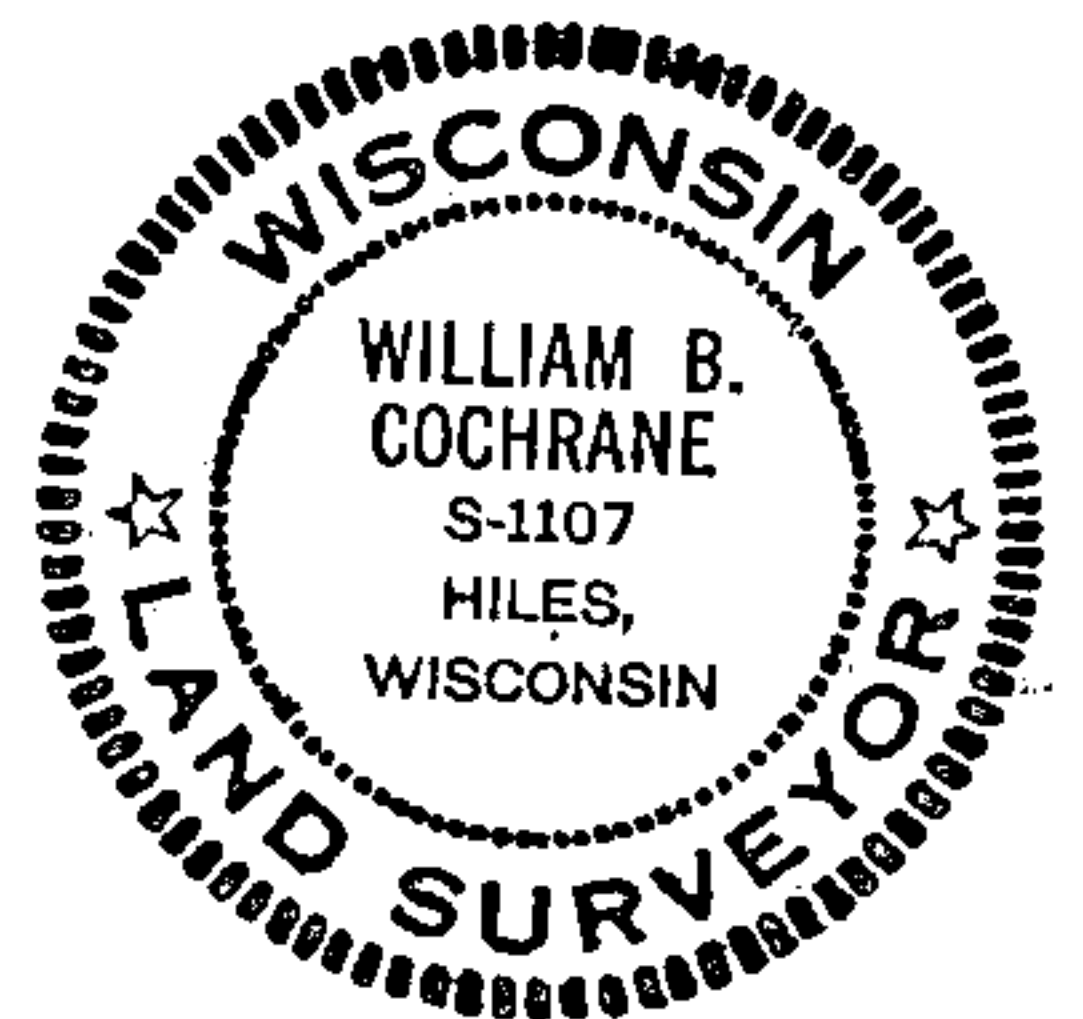

● - Corner monument restored
□ -

Resident witnesses _____
Dated at Hiles Wisconsin, this 12th day of September 1983.
Signature William B. Cochrane Title Land Surveyor
(County Surveyor, Registered Land Surveyor, or other duly authorized official)
Surveyors Registration No. 5-1107
Office of Register of Deeds County of Forest
I hereby certify that the within instrument was filed in this office for record on the 7th day of October 1983, and was filed in Book No. _____ Page No. _____ of County Records.
Signature Eugene Stetson Title Register of Deeds

Township 38 North, Range 14 East, Section 13, Index No. N-21, Page No. 1

43814140000

22