

U.S. PUBLIC LAND SURVEY MONUMENT RECORD

Index No. T-13

State of Wisconsin }
County of FOREST } ss.

I John Schulke, do hereby
certify that on the 28th day
of August, 1985, I found
evidence of the Quarter
corner of Sections 27 and 28
Township 41, North, Range
13 East, Fourth Principal Meridian,
as described hereon; and that from this evidence
I established a new monument and accessories
as described hereon to perpetuate the original
location of this corner.

Resident witnesses:

History of original corner establishment:

Original corner was established by Wm. Daugherty, Deputy Surveyor in June 1865
in the survey of the subdivision of T41N, R13E.

Original Bearing Trees:	W. Pine	15"	S56°E	18 lks.
	Tamarack	12"	S57°W	10 lks.

Description of corner evidence found:

Found 2" Dia. iron pipe set by Guy Veal in 1942 with a brass cap stamped to identify
the corner. Decayed wooden post laying beside the monument.

Recovered 1942 Bearing				
Trees:	Cedar	22"	N19°E	30.63 feet
	Cedar	18"	N55°W	47.76 feet


Recovered 1865 Bearing				
Trees:	W. Pine stump	18"	S56°E	11.88 feet

Description of monument and accessories I established to perpetuate the original location of this corner.

Steel sign post set within two feet NW of the monument.

Blazed and scribed the following new bearing trees:

	Poplar	19"	S70°W	34.50 feet
	Cedar	19"	S33°E	8.64 feet

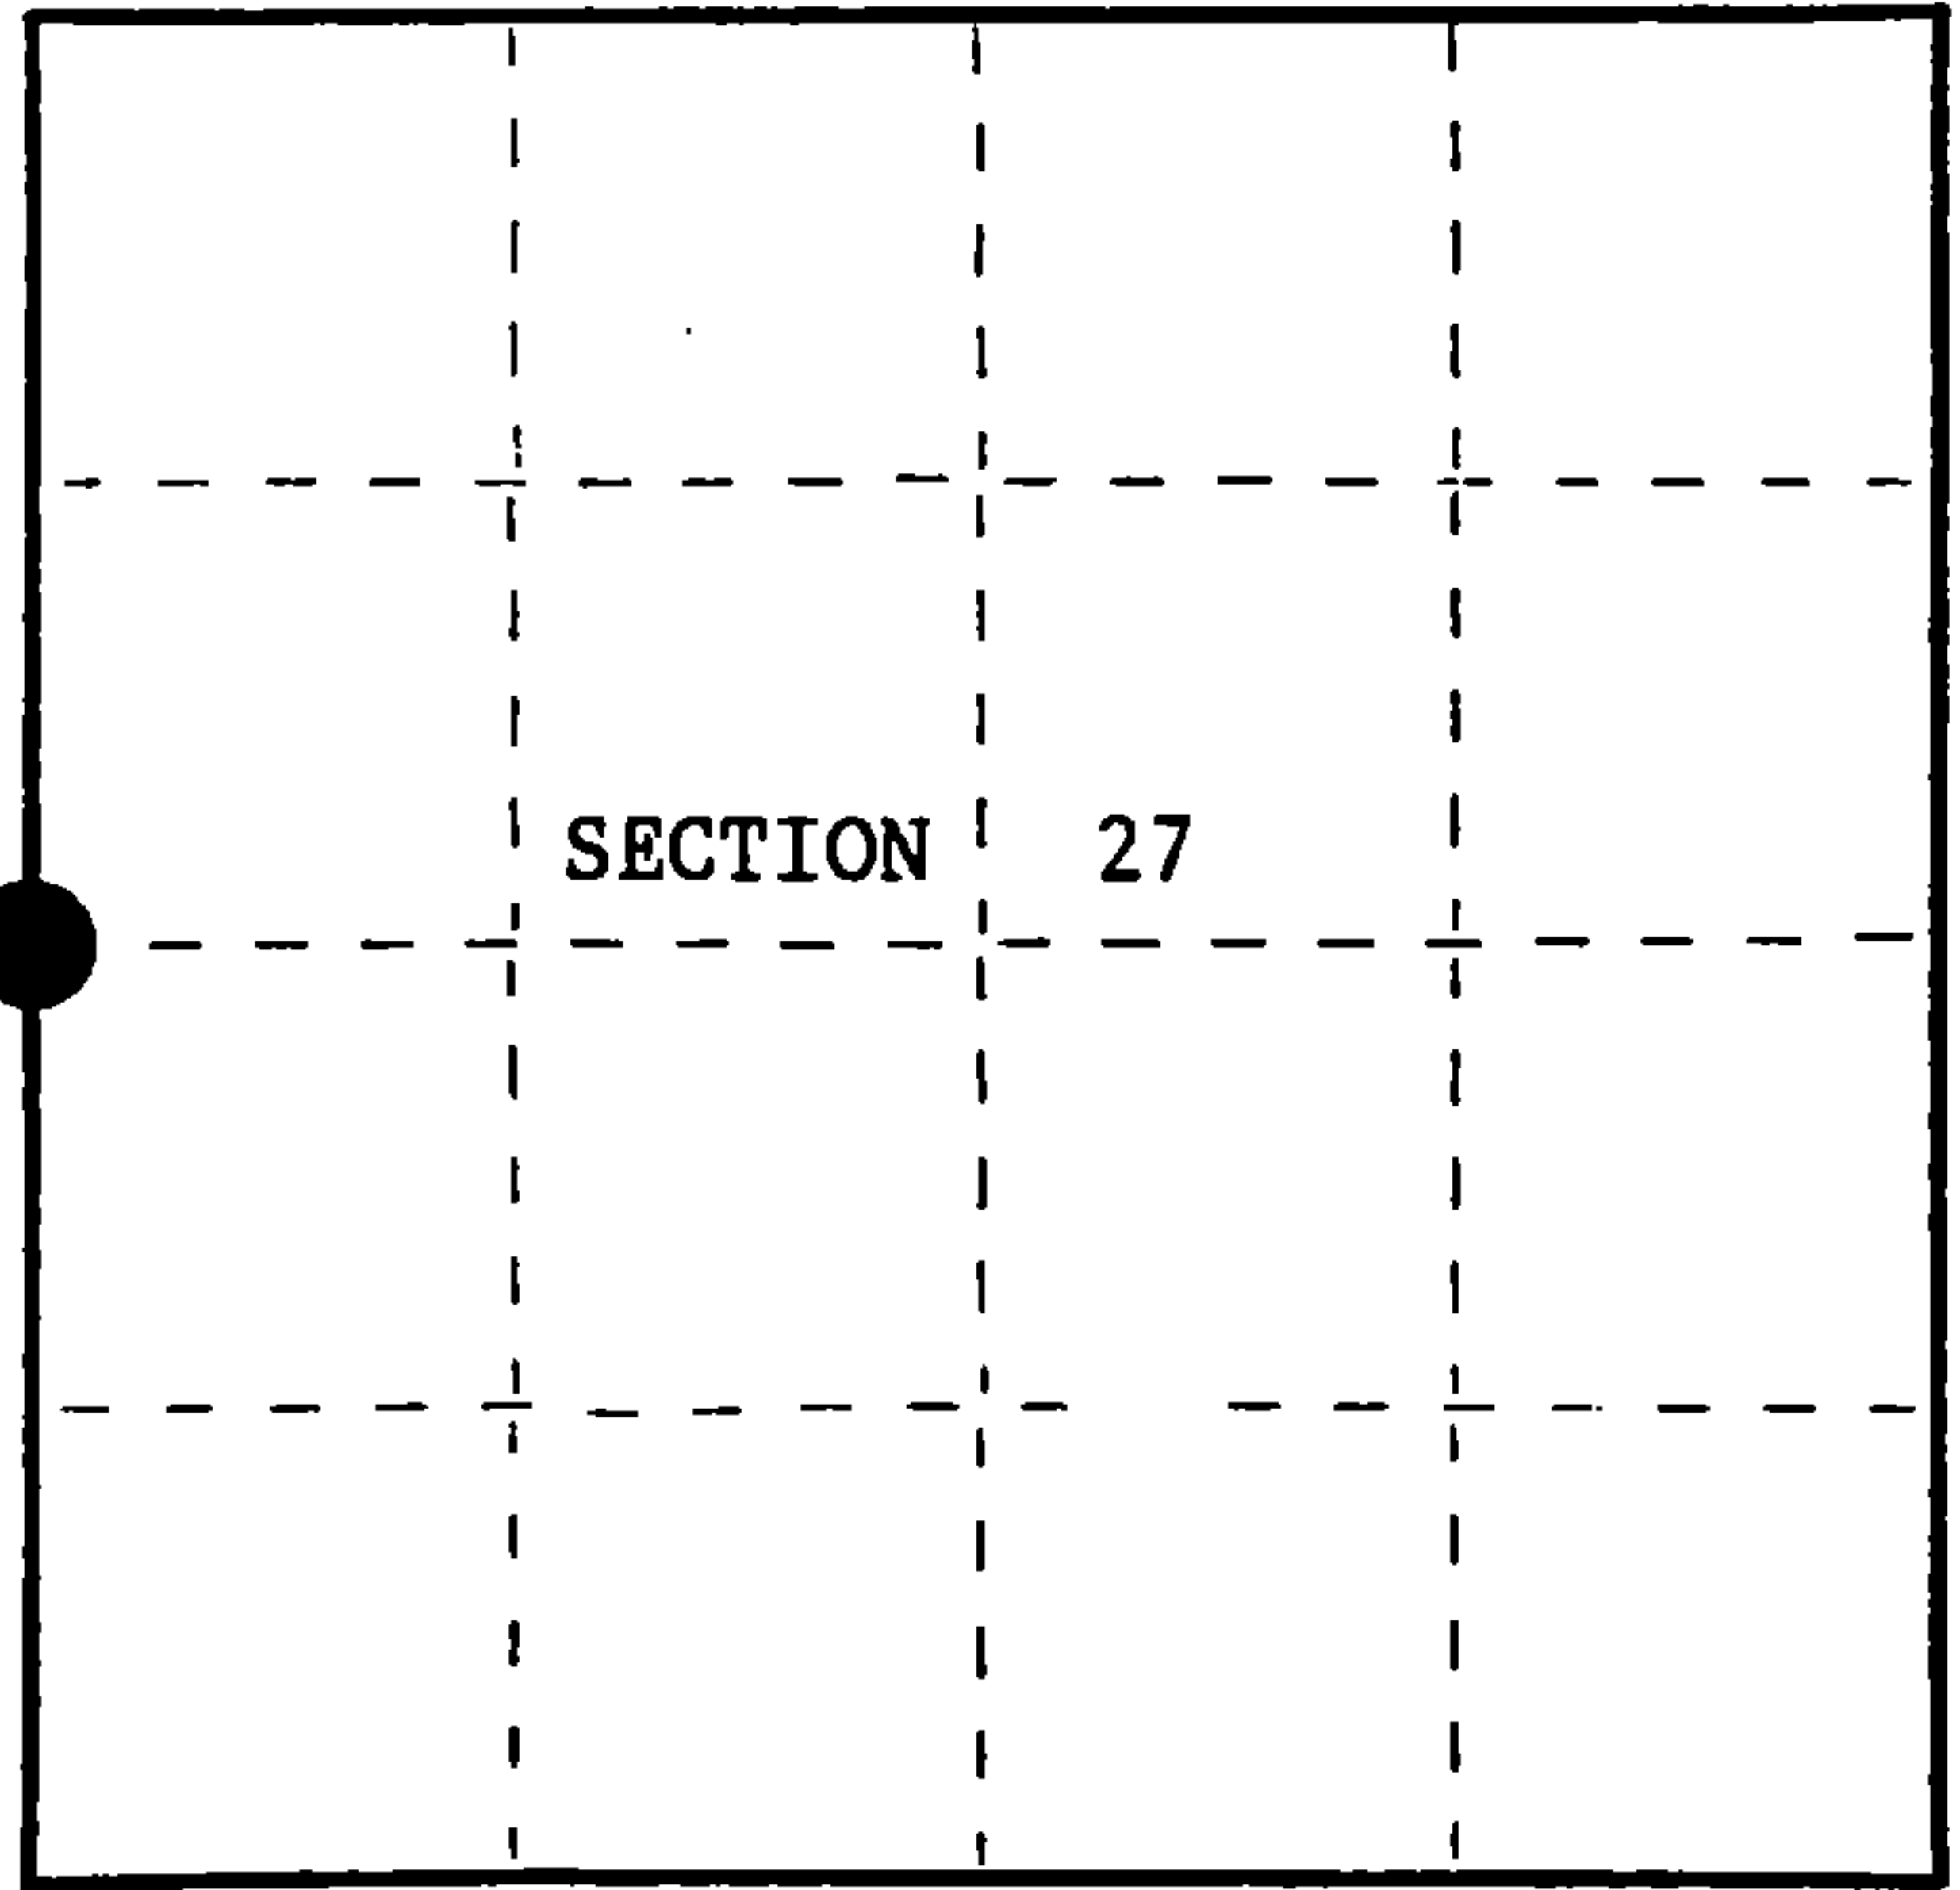

○ = Corner monument restored.

Dated at Crandon, Wis., this 10th day of October, 1985

Signature John C. Schulke Title R.L.S. Registration No. S-1665
(County Surveyor, Registered Land Surveyor, or other duly authorized official)

Office of Register of Deeds, County of Forest
I hereby certify that the within
instrument was filed in this office for record on the 21st day of November, 1985
at 1:10 o'clock P. M.

Paul Aschenbrenner
(Register of Deeds)



By Deputy

(e) Describe any material discrepancy between the location of the corner as restored or reestablished and the location of that corner as previously restored or reestablished by distance and direction. Show the discrepancy on the plan view drawing under (d), above. Show the distances between the corner as previously restored or reestablished and (1) the corner as restored or reestablished, and (2) to at least 2 of the witness monuments shown on the drawing in (d), above.

NONE

(f) Was the corner restored through acceptance of (1) an obliterated evidence location, or, (2) a found perpetuated location?

(g&h) Was the corner reestablished through lost corner proportionate methods? If so, show the method, including the directions and distances to other public land survey corners used as evidence or used for proportioning in determining the corner location?

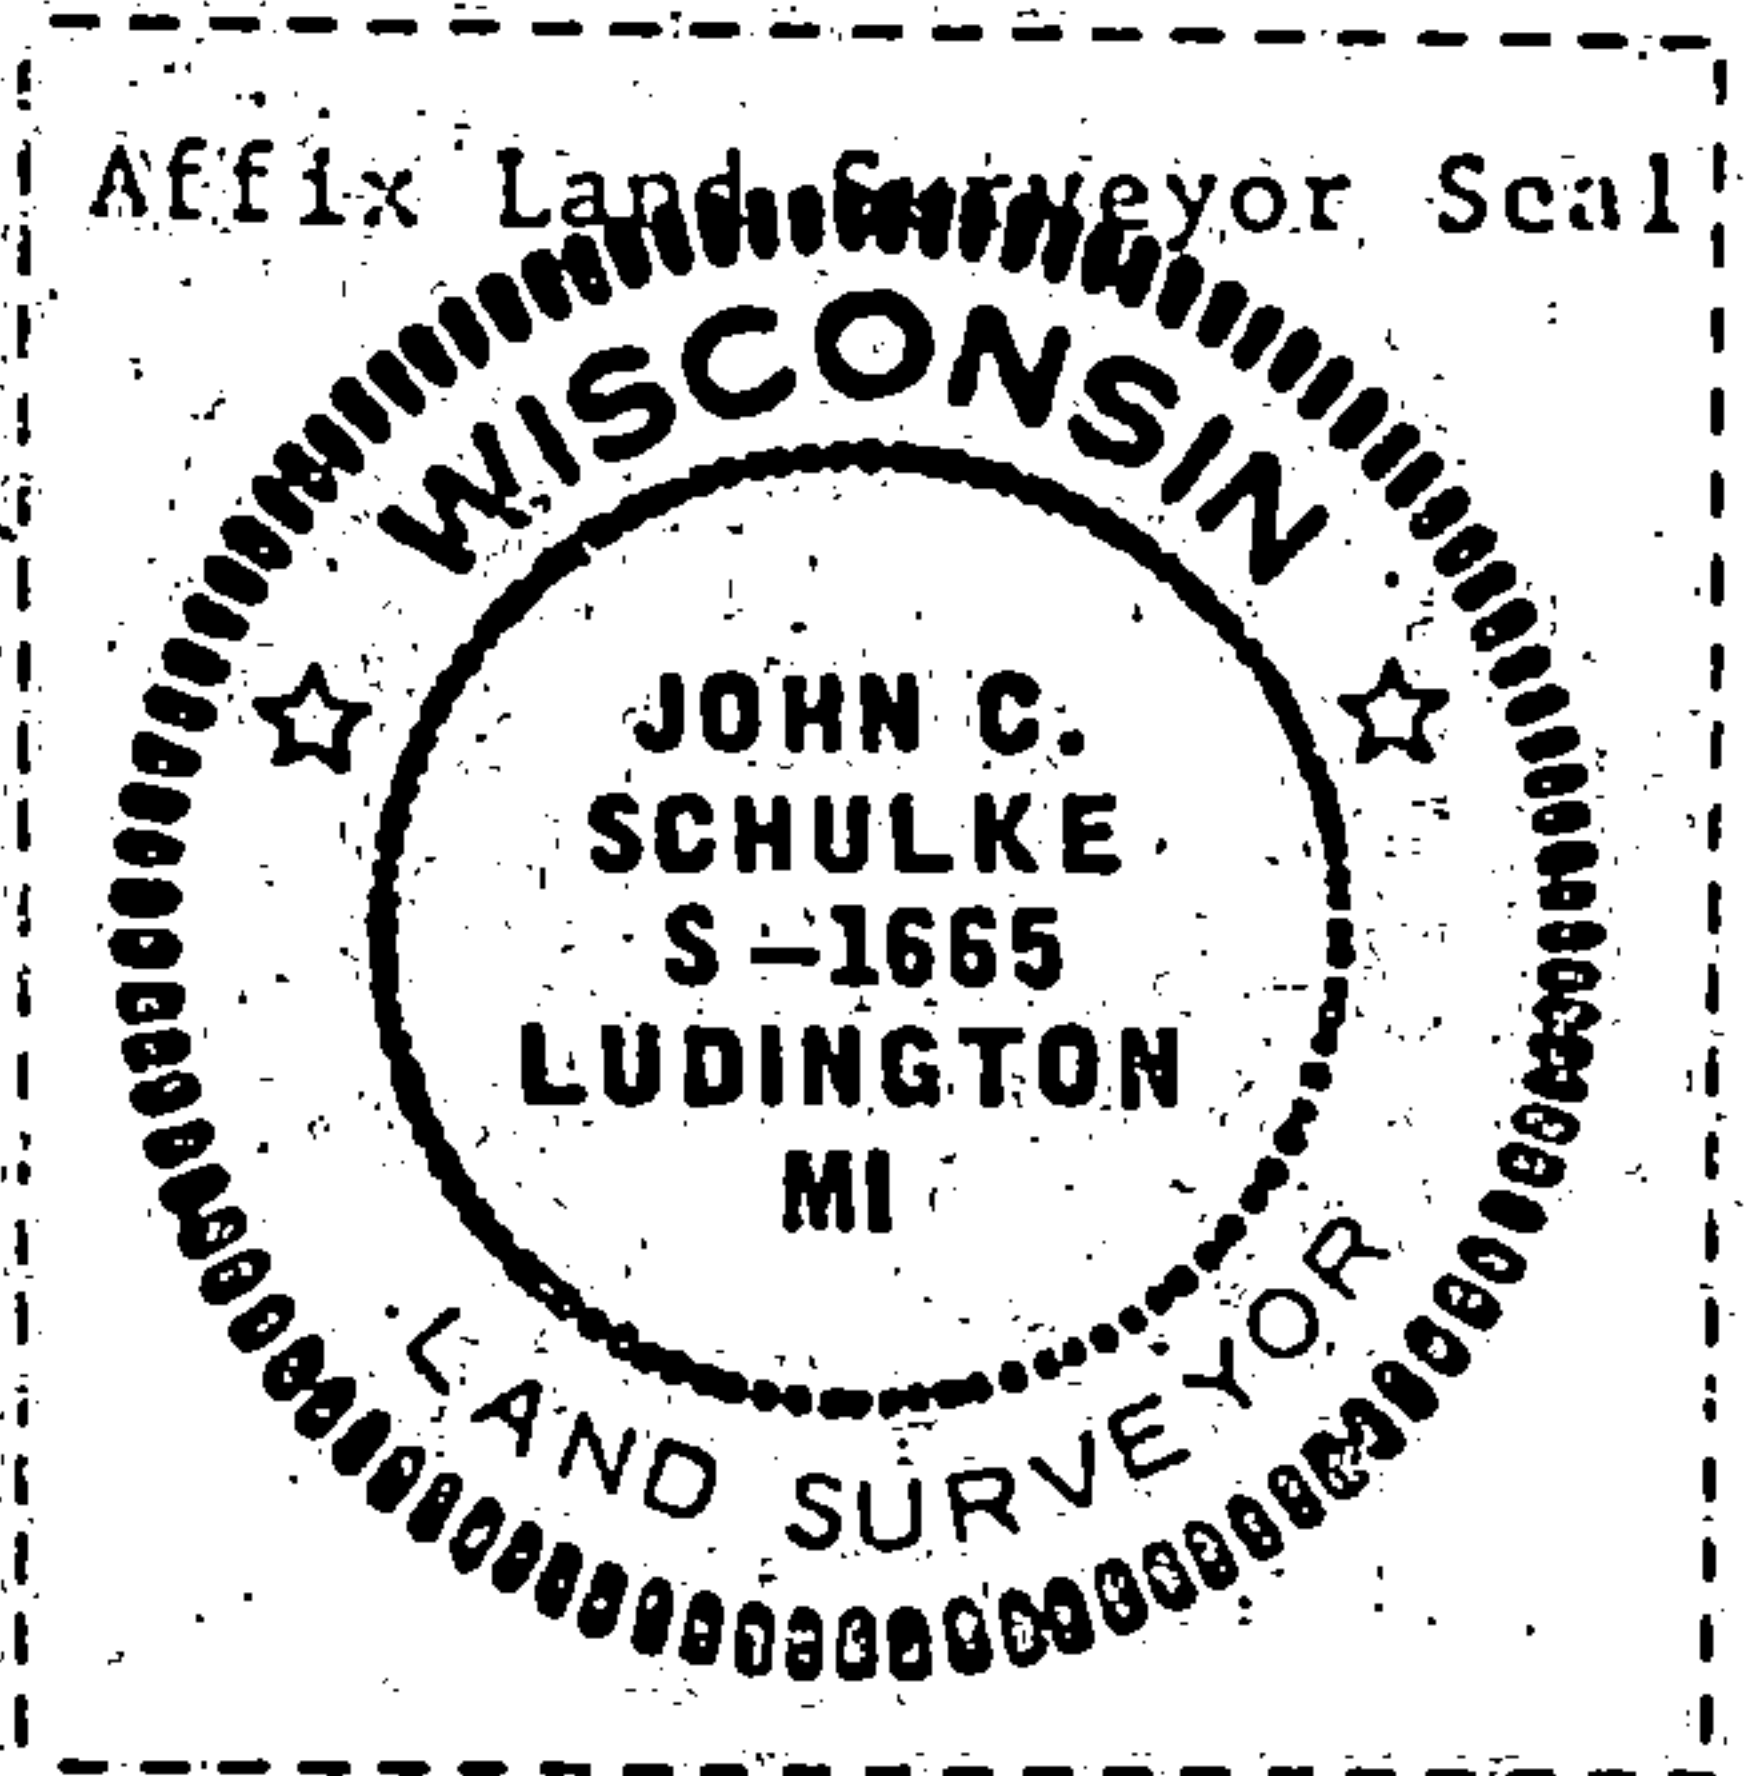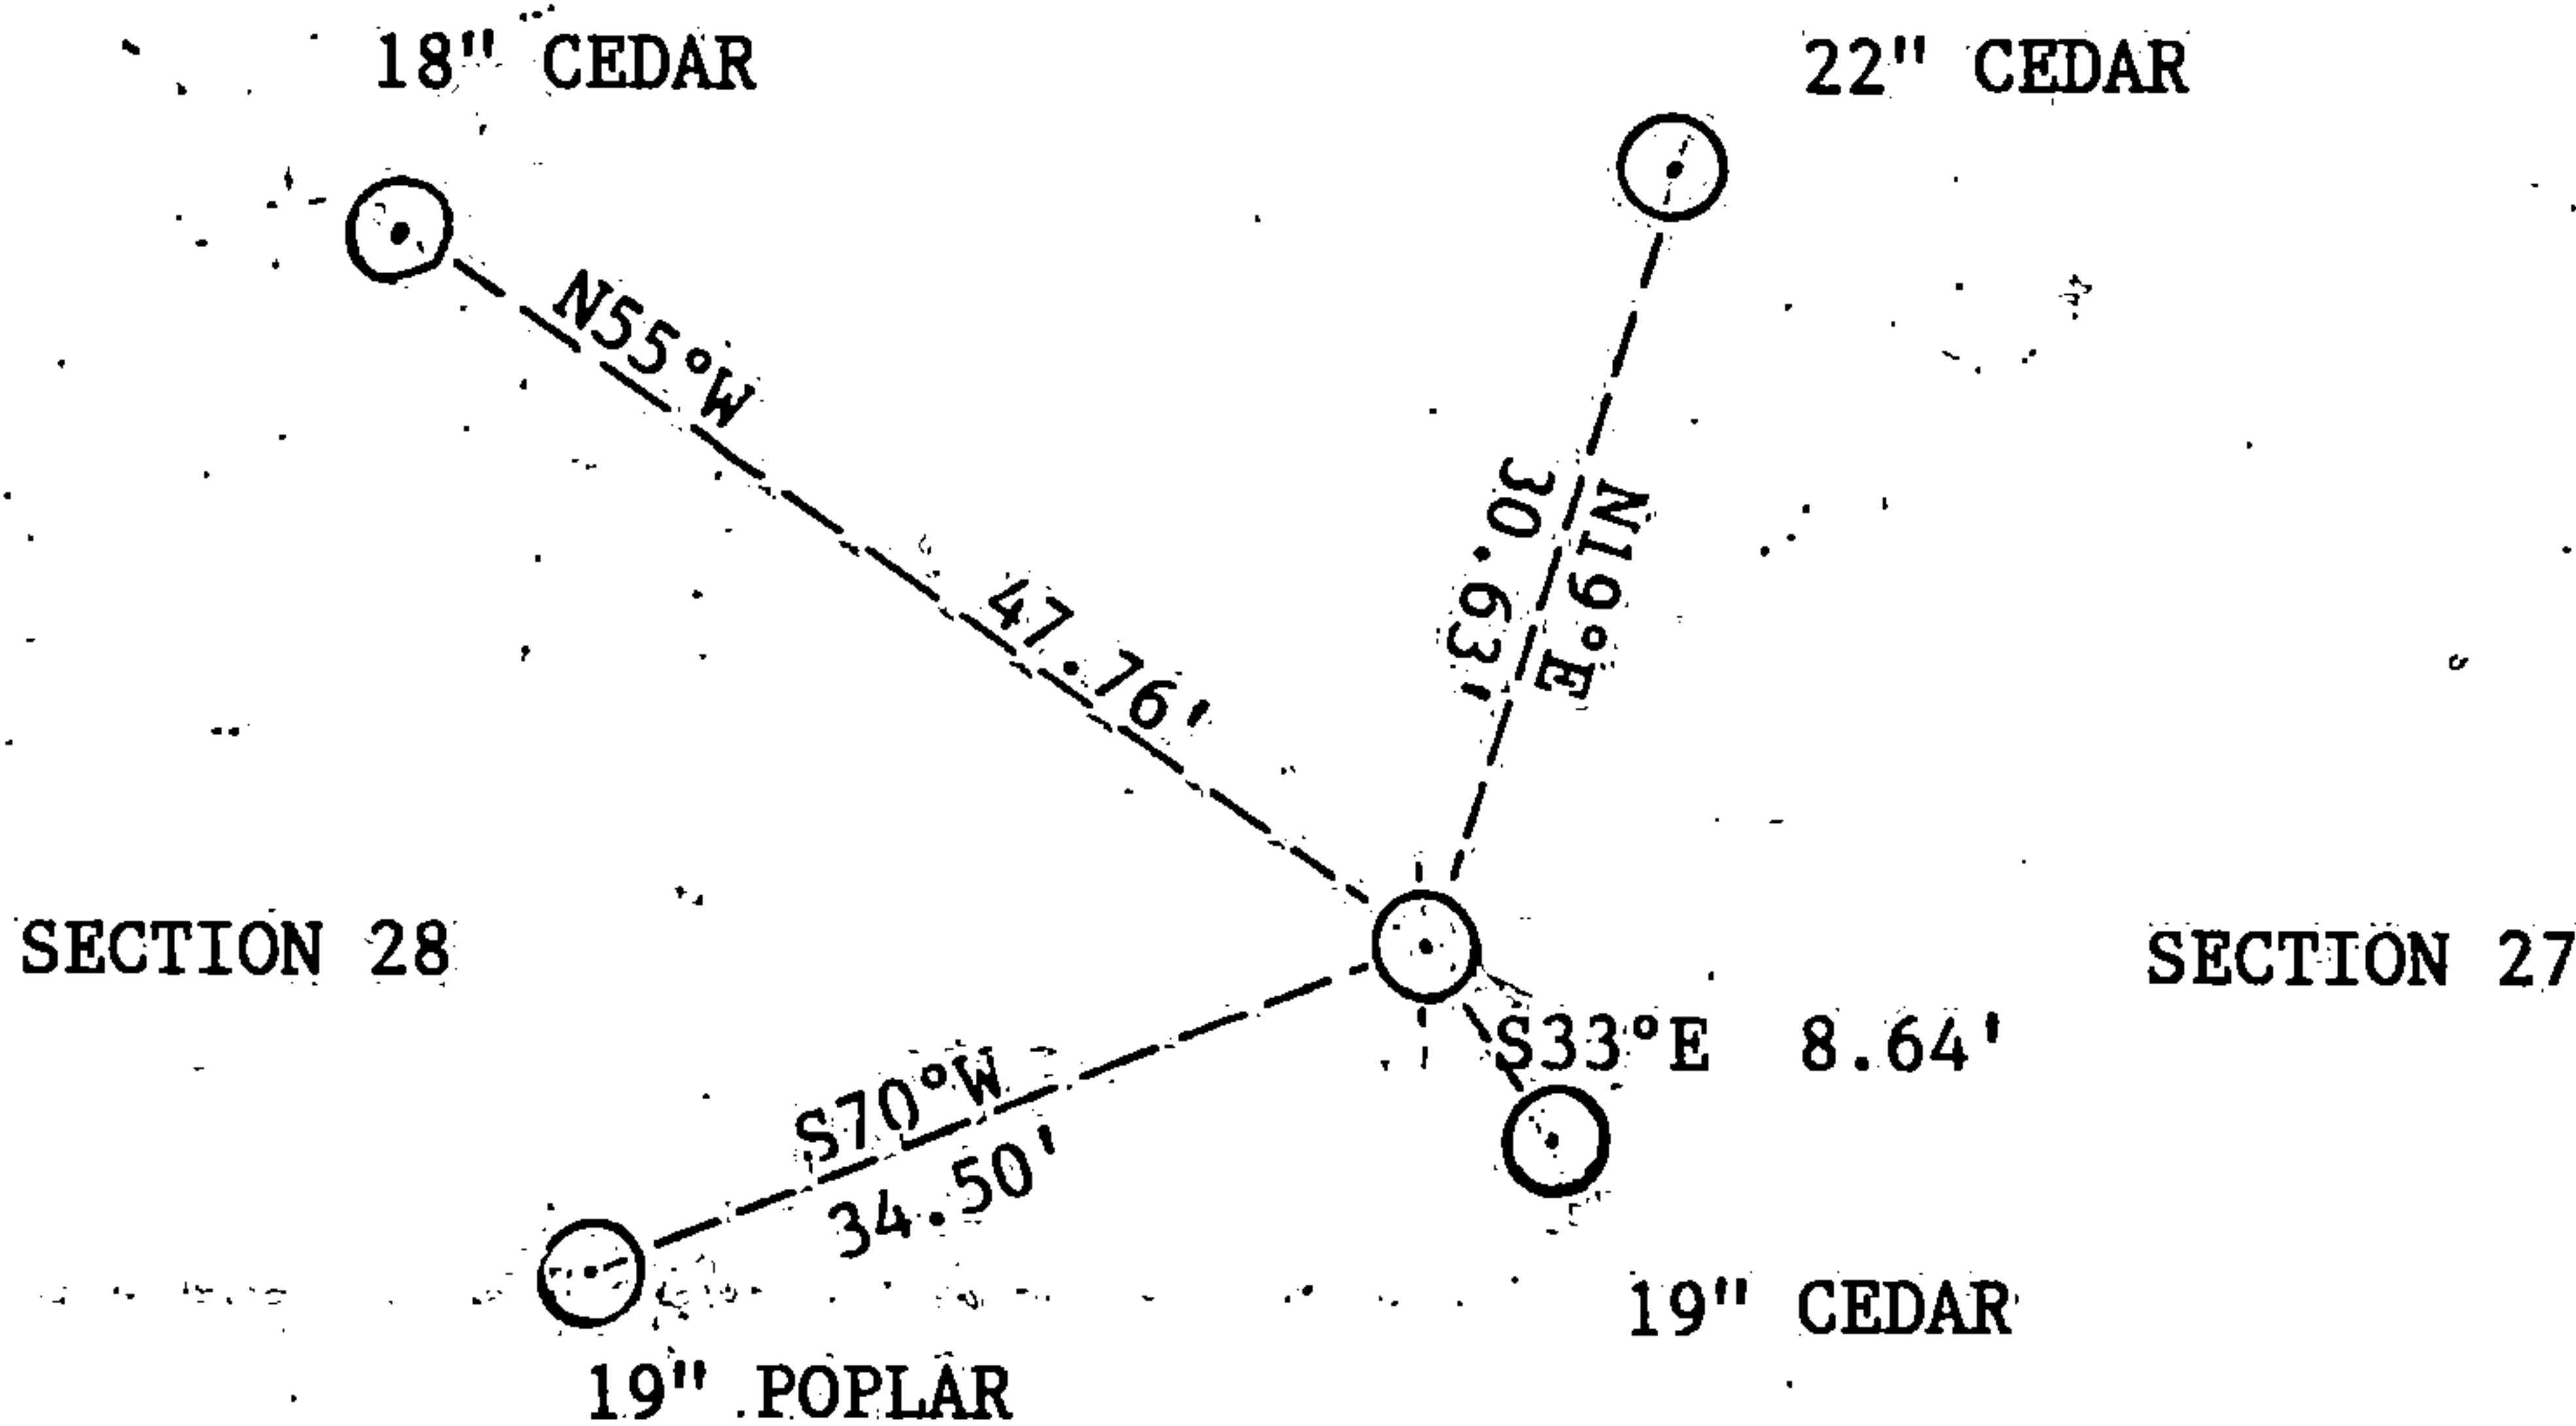

(i) I, John C. Schulke, R.L.S.
(type or print name), certify that the corner location shown on this record was determined by me or under my direction and control and that this U.S. Public Land Survey Monument Record is correct and complete to the best of my knowledge and belief.

John C. Schulke
Signature

Oct 10, 1985
Date